




19139 10-MI209

This solenoid has one unique features that may cause rebuilder and installers some easily corrected problems. The S terminal is the big ring around the b terminal. See Picture:

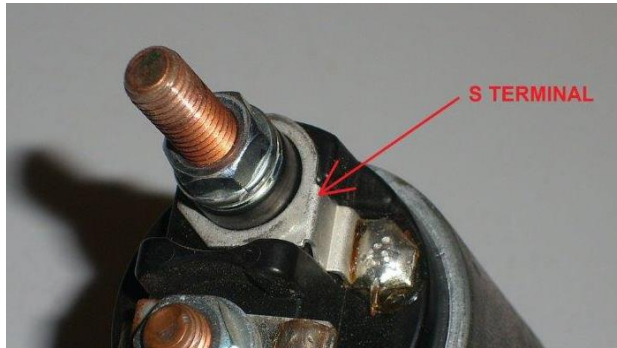

If the B+ plastic starter connection cover is damaged or the wave spring is rusted on the car this starter is installed on, the starter will not crank. The good thing is this plastic piece is available at a reasonable cost.



The part numbers for the starter connection cover is 68073159AA or 68119375AA. Current cost on internet is under \$5.00 I would recommend cleaning the terminal in the harness and a thin coat of dielectric silicone in high salt areas to prevent corrosion.